


WIRING DIAGRAM
FOR U.S.A. MODEL

1996 - 1997 GSXR 750

SP : SPEEDOMETER LIGHT
TA : TACHOMETER LIGHT
FU : FUEL LEVEL INDICATOR LIGHT
NU : NEUTRAL INDICATOR LIGHT
HI : HIGH BEAM INDICATOR LIGHT
TU : TURN SIGNAL INDICATOR LIGHT

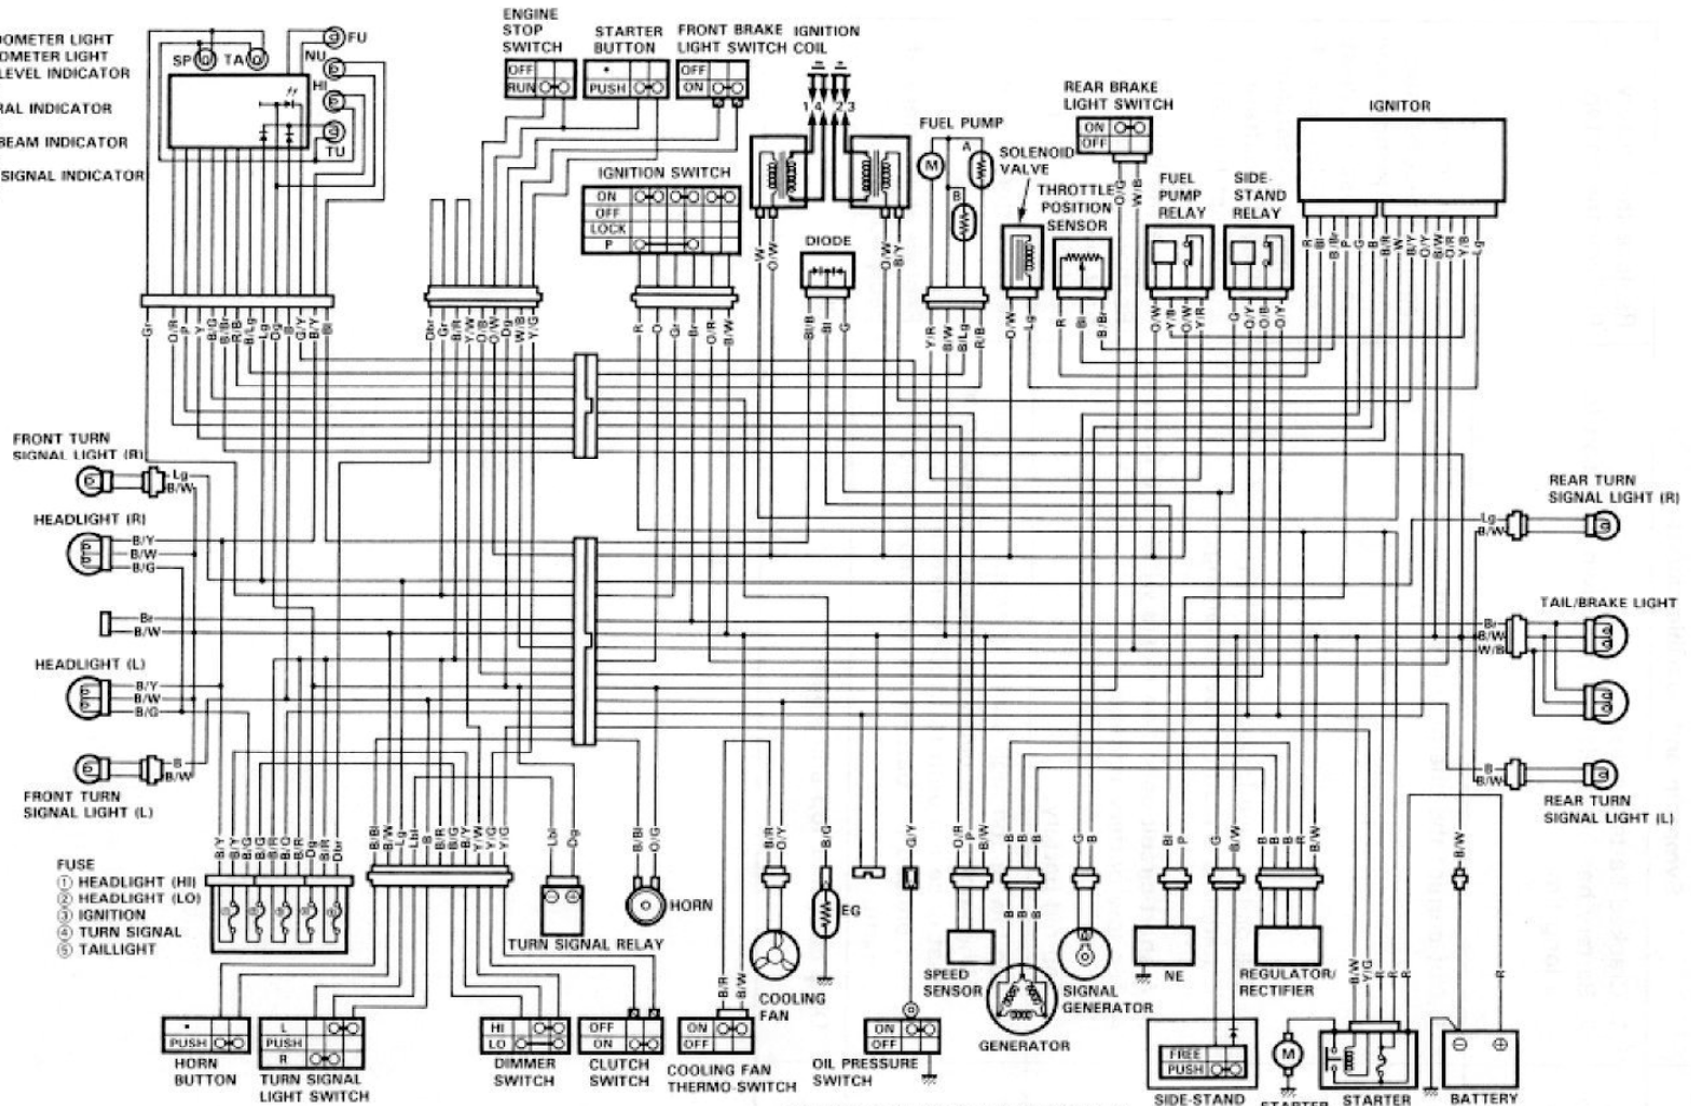

FUSE
① HEADLIGHT (HI)
② HEADLIGHT (LO)
③ IGNITION
④ TURN SIGNAL
⑤ TAILLIGHT

WIRE COLOR
B Black
Bl Blue
Br Brown
Dbr . . . Dark brown
Dg Dark green
G Green
Gr Gray
Lbl . . . Light blue
Lg Light green

O Orange
P Pink
R Red
W White
Y Yellow
B/Br . . Black with Brown tracer
B/G . . . Black with Green tracer
B/Bl . . Black with Blue tracer
B/Lg . . Black with Light green tracer

EG : ENGINE COOLANT TEMPERATURE GAUGE
NE : NEUTRAL INDICATOR LIGHT SWITCH
B/O . . . Black with Orange tracer
B/R . . . Black with Red tracer
B/W . . . Black with White tracer
B/Y . . . Black with Yellow tracer
Bl/B . . Blue with Black tracer
G/Y . . . Green with Yellow tracer
O/B . . . Orange with Black tracer
O/G . . . Orange with Green tracer
O/R . . . Orange with Red tracer

O/W . . . Orange with White tracer
O/Y . . . Orange with Yellow tracer
R/B . . . Red with Black tracer
W/B . . . White with Black tracer
Y/B . . . Yellow with Black tracer
Y/G . . . Yellow with Green tracer
Y/R . . . Yellow with Red tracer
Y/W . . . Yellow with White tracer